


## CODED NOTES

- 1) SAWCUT EXISTING PANELS TO FULL DEPTH PRIOR TO DEMOLITION. INSTALL NEW CONCRETE PAVEMENT PER DETAIL. DOWEL IN JOINTS 8" O.C.
- (2) EXISTING TRENCH DRAIN AND CATCH BASINS ARE TO REMAIN. PROTECT EXISTING STRUCTURES DURING DEMOLITION OF CONCRETE PAVEMENT.
- REMOVE AND REPLACE CONCRETE FLOOR IN GARAGE BAYS. SAW CUT AND REMOVE BROKEN CONCRETE. COMPACT EXISTING AGGREGATE BASE, DOWEL IN JOINTS 6" O.C., SEAL AND PAINT FLOOR. COORDINATE WITH OWNER FOR COLORS. TYPICAL OF 2-3'X6' AREAS.
- 4 PROPOSED MONUMENT SIGN (BY OTHERS). PROVIDE POWER FOR LIGHTING FROM ADJACENT LIGHT POLE IN 2" CONDUIT.

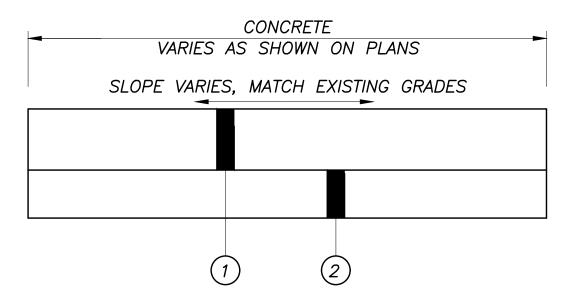

- (1) ITEM 452 8" NON-REINFORCED CONCRETE PAVEMENT (DOWLED JOINTS)
- (2) EXISTING AGGREGATE BASE TO BE REDRESSED AND COMPACTED


\*PROVIDE 10" THICKENED EDGE AT OUTER 4 FEET OF SLAB

## CONCRETE PAVEMENT SECTION NO SCALE

ESTIMATE OF QUANTITIES				
ITEM	QUANTITY	UNIT	DESCRIPTION	
202	1082	S.Y.	PAVEMENT REMOVED	
<i>452</i>	1082	S.Y.	NON-REINFORCED CONCRETE PAVEMENT	
SPEC	4	S.Y.	INTERIOR CONCRETE FLOOR REPAIR, 10" THICK	


WORK IS TO BE PHASED TO MAINTAIN USE OF FIRE APPARATUS. COORDINATE WITH OWNER.

## <u>LEGEND</u>



CONCRETE PANELS TO BE REMOVED AND REPLACED PER DETAIL. MATCH EXISTING CONTROL JOINTS.

INTERIOR CONCRETE FLOOR TO BE REMOVED AND REPLACED. SEAL AND PAINT CONCRETE TO MATCH EX.

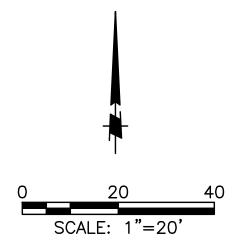

#	Date	Change Description				
	Station 134 Concrete Repair					



Mifflin Township



DESIGN DEVELOPMENT

**300 SPRUCE STREET** SUITE 200 COLUMBUS, OHIO 43215 P: 614 280 8999

MOODY-ENG.COM

Dwg. Coord.: JDL Tech. Coord.: M-E#: 19029 SITE PLAN C101

**PROGRESS** 

DRAWING

NOT FOR

CONSTRUCTION

October 1, 2019